



CCTV Inspection Report

Project Name: Terrace - Sewer
Address: Terrace
Client: Contracting
Authority: G
Inspection Company: Pipeline Services Group
Construction: Contracting
Start Date: 28/01/2026



Table of Contents

Project Name	Project Number	Start Date
- Sewer	003	28/01/2026

Pipe List	Page 3
Section No. 1 - E8/1-MH7/1 - Section Inspection	Page 4
Section No. 1 - E8/1-MH7/1 - Section Pictures	Page 5
Section No. 1 - E8/1-MH7/1 - Section Inclination	Page 6
Section No. 2 - MH7/1-MH6/1 - Section Inspection	Page 7
Section No. 2 - MH7/1-MH6/1 - Section Pictures	Page 8
Section No. 2 - MH7/1-MH6/1 - Section Inclination	Page 9
Section No. 3 - MH6/1-MH5/1 - Section Inspection	Page 10
Section No. 3 - MH6/1-MH5/1 - Section Pictures	Page 11
Section No. 3 - MH6/1-MH5/1 - Section Inclination	Page 12
Section No. 4 - MH5/1-MH4/1 - Section Inspection	Page 13
Section No. 4 - MH5/1-MH4/1 - Section Pictures	Page 14
Section No. 4 - MH5/1-MH4/1 - Section Inclination	Page 15
Section No. 5 - MH4/1-MH3/1 - Section Inspection	Page 16
Section No. 5 - MH4/1-MH3/1 - Section Pictures	Page 17
Section No. 5 - MH4/1-MH3/1 - Section Inclination	Page 18
Section No. 6 - MH3/1-MH2/1 - Section Inspection	Page 19
Section No. 6 - MH3/1-MH2/1 - Section Pictures	Page 20
Section No. 6 - MH3/1-MH2/1 - Section Inclination	Page 21
Section No. 7 - MH2/1-EX1/1 - Section Inspection	Page 22
Section No. 7 - MH2/1-EX1/1 - Section Pictures	Page 23
Section No. 7 - MH2/1-EX1/1 - Section Inclination	Page 24



Pipe List


Project Name Terrace - Sewer	Project Number 003	Start Date 28/01/2026
---------------------------------	-----------------------	--------------------------

Section No.	Start Node	Finish Node	Inspection Date	Pipe Address	Pipe Material	Inspected Length	Pipe ID
1	MH7/1	E8/1	28/01/2026	Terrace	PVC	4.33m	E8/1-MH7/1
2	MH7/1	MH6/1	28/01/2026	Terrace	PVC	11.98m	MH7/1-MH6/1
3	MH6/1	MH5/1	28/01/2026	Terrace	PVC	10.6m	MH6/1-MH5/1
4	MH5/1	MH4/1	28/01/2026	Terrace	PVC	22.47m	MH5/1-MH4/1
5	MH4/1	MH3/1	28/01/2026	Terrace	PVC	69.15m	MH4/1-MH3/1
6	MH3/1	MH2/1	28/01/2026	Terrace	PVC	28.12m	MH3/1-MH2/1
7	MH2/1	EX1/1	28/01/2026	Terrace	PVC	13.56m	MH2/1-EX1/1



Section Inspection - Section 1 - E8/1-MH7/1

Project Name E8/1 - Sewer		Project Number 003	Start Date 28/01/2026
Inspection Address E8/1 Terrace	Section Name E8/1-MH7/1	Section No. 1	Inspection Date 28/01/2026
Time 08:19:15	Inspection Code WSA 05 2020 4.1	Authority GRC	Inspector Paul
Location Type: Public Land US/MH: E8/1 Installed Length: 5.501	Operation: Gravity DS/MH: MH7/1 Inspected Length: 4.33	Use: Sewer Direction: Upstream Age: 1	
Profile: Circular Dia/Height: 150 Material: PVC Lining Material: N/A Lining Type: N/A		Purpose: New Construction Method: CCTV Precipitation: None Cleaned: Yes Flow Control: None	

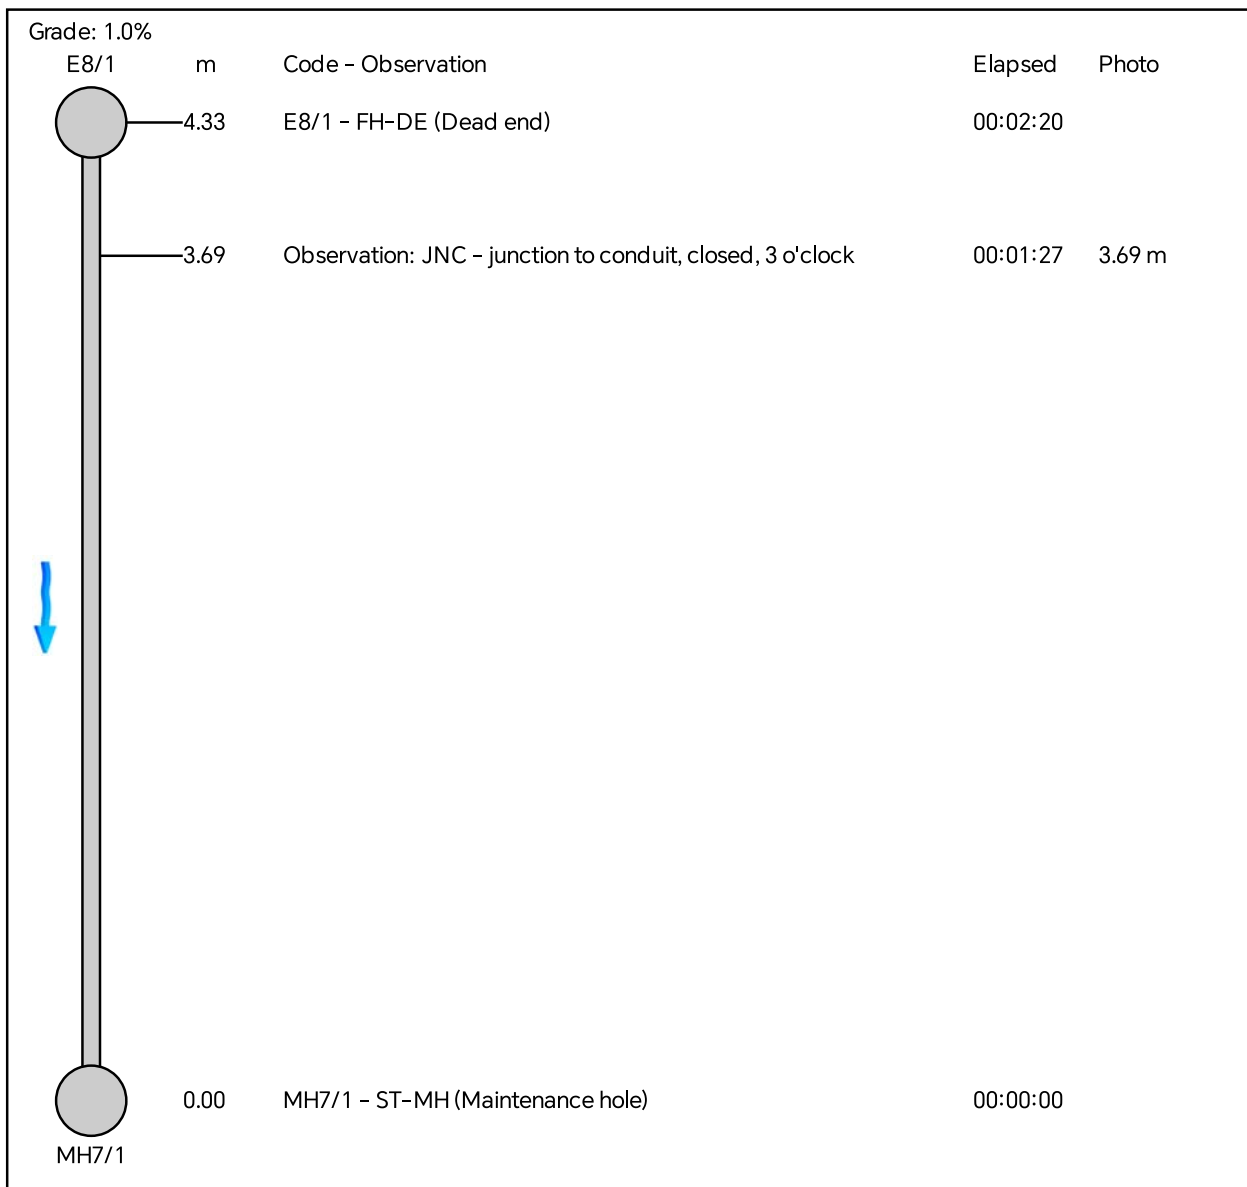

Str Defects	Str Peak	Str Mean	Str Total	Str Grade	Serv Defects	Serv Peak	Serv Mean	Serv Total	Serv Grade
0	0.0	0.0	0.0	1	0	0.0	0.0	0.0	1



Section Pictures - MH7/1 to E8/1

Project Name Lot 42 Meridian Terrace - Sewer		Project Number 003	Start Date 28/01/2026
Inspection Address Meridian Terrace	Section Name E8/1-MH7/1	Section No. 1	Inspection Date 28/01/2026



Photo 1 — Distance: 3.69 m



Pipeline Services Group Pty Ltd
3180 Old Gympie Road, Beerwah, Q, 4519
0455 717 128
admin@pipelineservicesgroup.com.au

Section Inclination - MH7/1 to E8/1 - 28/01/2026

Project Name
Lot 42 Meridian Terrace - Sewer

Project Number
003

Start Date
28/01/2026

— Pipe Design
— Pipe Actual


Inclination Report

Measured distance: 4.33m

Direction of Travel: →

E8/1


MH7/1

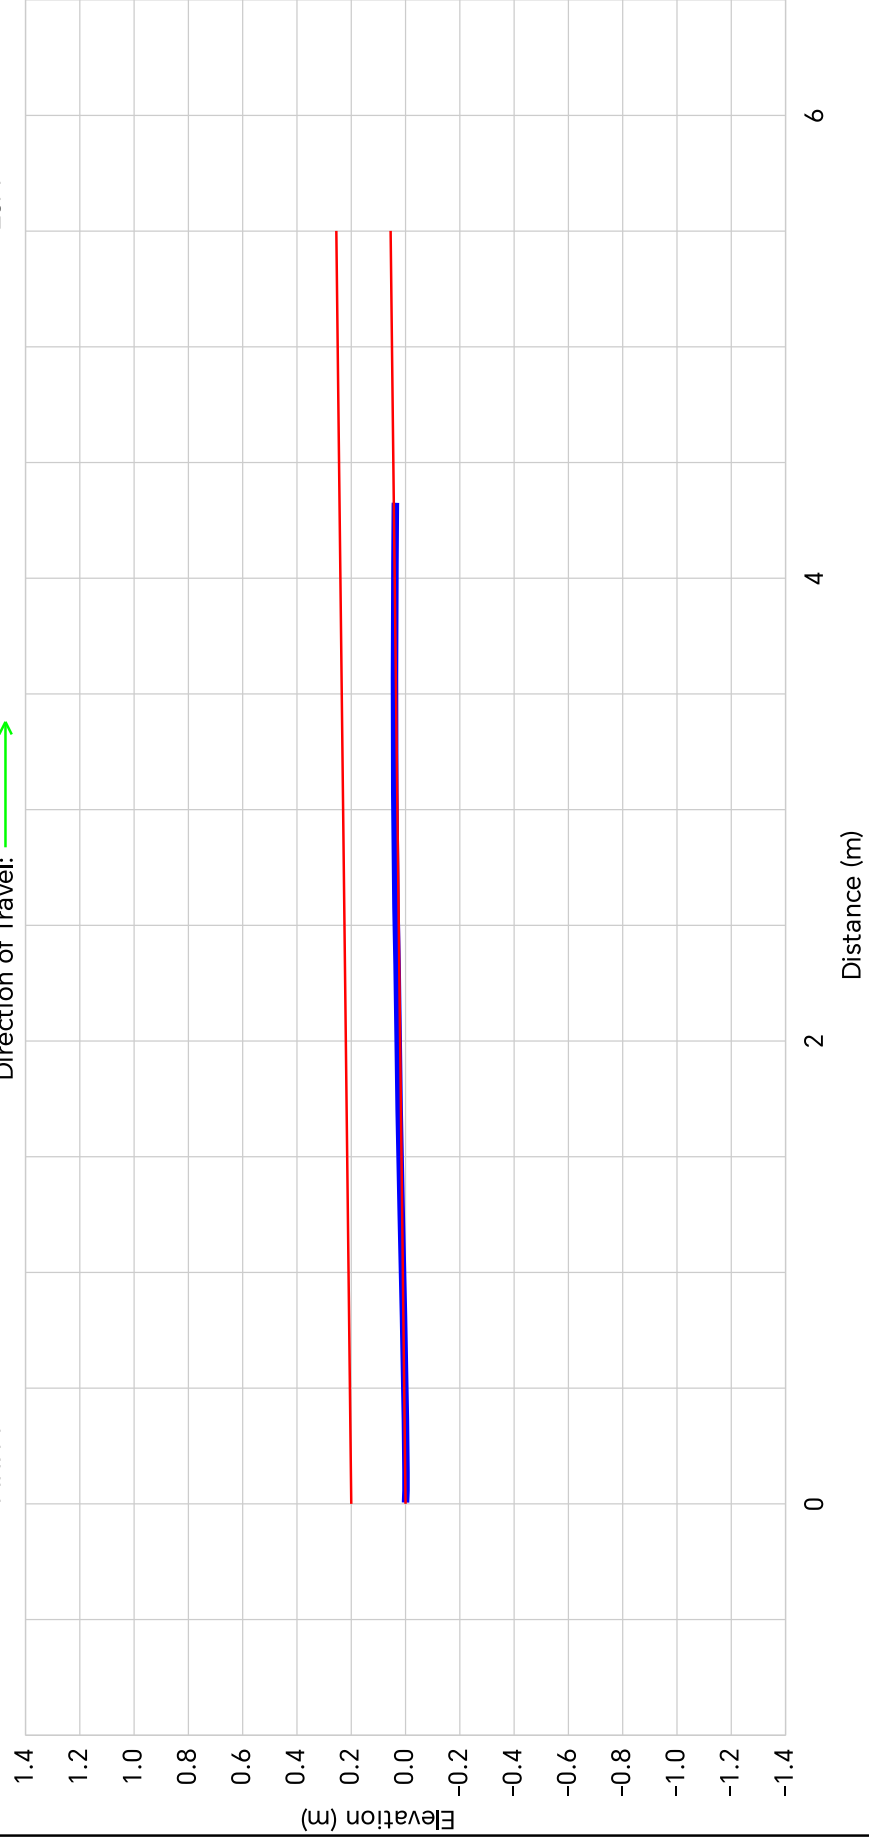



Section Inspection - Section 2 - MH7/1-MH6/1

Project Name Terrace - Sewer		Project Number 003	Start Date 28/01/2026
Inspection Address Terrace	Section Name MH7/1-MH6/1	Section No. 2	Inspection Date 28/01/2026
Time 08:24:31	Inspection Code WSA 05 2020 4.1	Authority GRC	Inspector Paul
Location Type: Public Land US/MH: MH7/1 Installed Length: 12.448	Operation: Gravity DS/MH: MH6/1 Inspected Length: 11.98	Use: Sewer Direction: Downstream Age: N/A	
Profile: Circular Dia/Height: 150 Material: PVC Lining Material: N/A Lining Type: N/A		Purpose: New Construction Method: CCTV Precipitation: None Cleaned: Yes Flow Control: No	

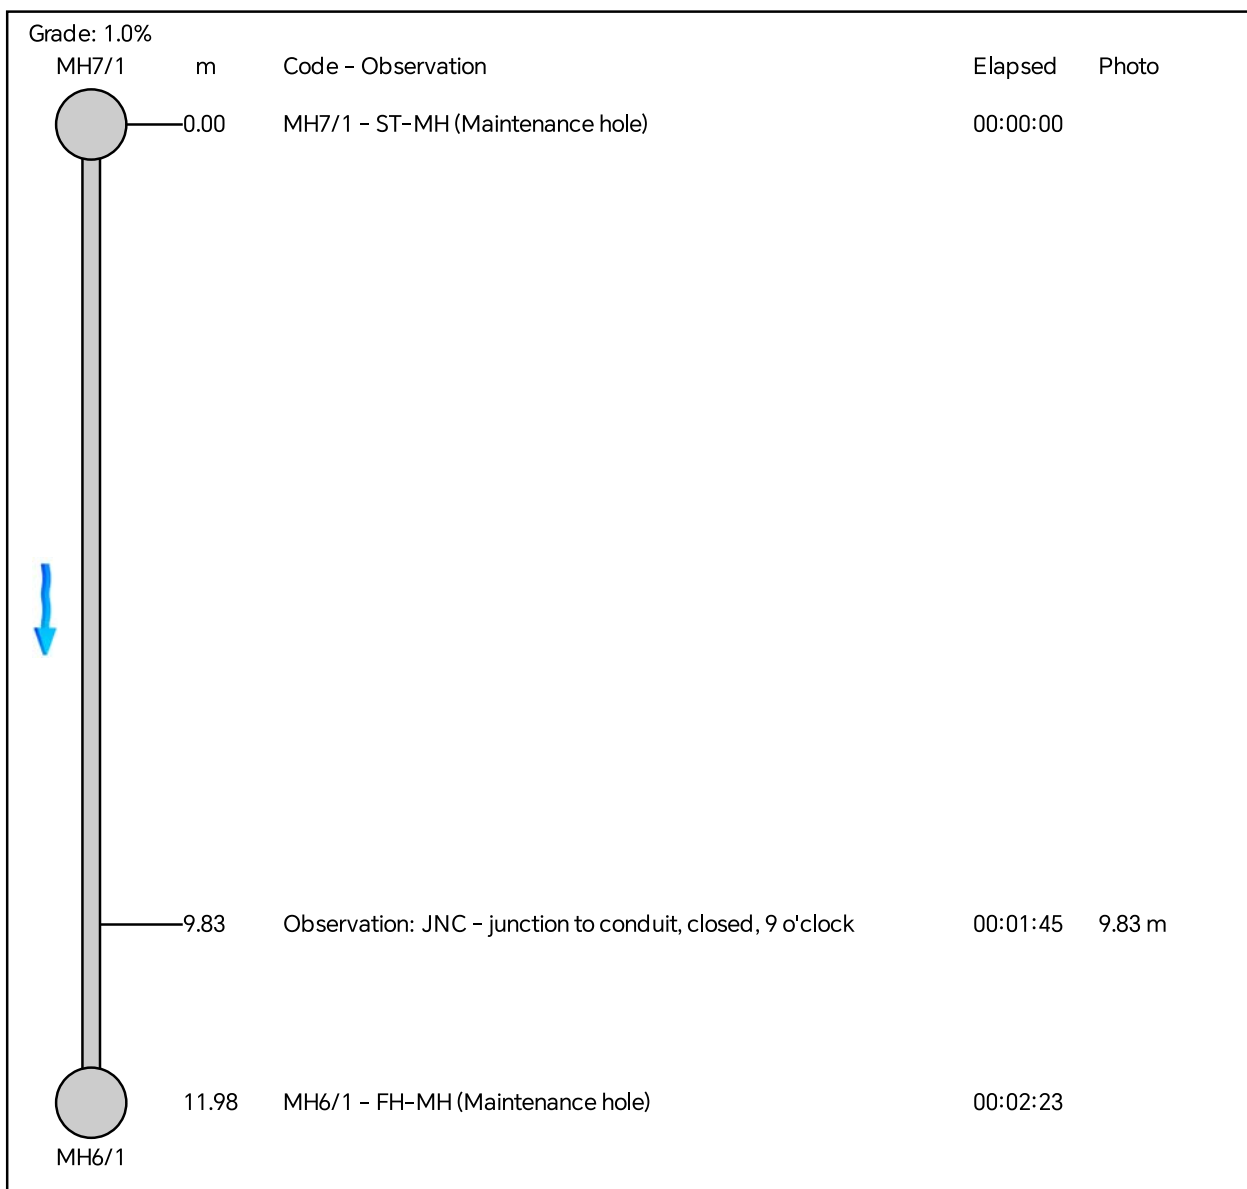

Str Defects	Str Peak	Str Mean	Str Total	Str Grade	Serv Defects	Serv Peak	Serv Mean	Serv Total	Serv Grade
0	0.0	0.0	0.0	1	0	0.0	0.0	0.0	1



Section Pictures - MH7/1 to MH6/1

Project Name Terrace - Sewer		Project Number 003	Start Date 28/01/2026
Inspection Address Meridian Terrace	Section Name MH7/1-MH6/1	Section No. 2	Inspection Date 28/01/2026



Photo 1 — Distance: 9.83 m



Pipeline Services Group Pty Ltd
3180 Old Gympie Road, Beerwah, Q, 4519
0455 717 128
admin@pipelineservicesgroup.com.au

Section Inclination - MH7/1 to MH6/1 - 28/01/2026

Project Name
Terrace - Sewer

Project Number
003

Start Date
28/01/2026

— Pipe Design
— Pipe Actual
MH6/1

Inclination Report

Measured distance: 11.98m

Direction of Travel: →

MH7/1

